


Заклепка открытого типа

Тип **SS**

Стандартный борт

Углеродистая сталь / Углеродистая сталь

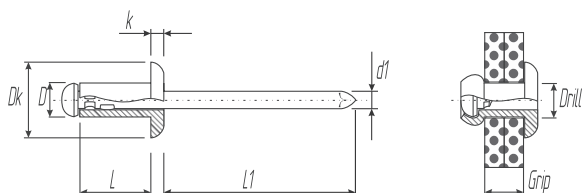


D, мм +0,08/-0,15	L, мм	Dk, мм	k, мм	d1, мм max	L1, мм min	Drill, мм	Grip, мм	H	H	Артикул
3,0	6,0	6,0 +0,3/-0,6	1,3	2,15	25	3,1	1,0-3,0	950	1100	SS 3006
	8,0						3,0-5,0			SS 3008
	10,0						5,0-7,0			SS 3010
	12,0						7,0-9,0			SS 3012
	14,0						9,0-11,0			SS 3014
	16,0						11,0-13,0			SS 3016
3,2	6,0	6,5 +0,2/-0,7	1,3	2,2	25	3,3	1,0-3,0	1100	1200	SS 3206
	8,0						3,0-5,0			SS 3208
	10,0						5,0-7,0			SS 3210
	12,0						7,0-9,0			SS 3212
	14,0						9,0-11,0			SS 3214
	16,0						11,0-13,0			SS 3216
4,0	6,0	8,0 +0,4/-1,1	1,7	2,8	27	4,1	1,0-3,0	1700	2200	SS 4006
	8,0						3,0-5,0			SS 4008
	10,0						5,0-6,5			SS 4010
	12,0						6,5-8,5			SS 4012
	14,0						8,5-10,5			SS 4014
	16,0						10,5-12,5			SS 4016
	18,0						12,5-14,5			SS 4018
	20,0						14,5-16,5			SS 4020
	25,0						16,5-21,5			SS 4025
	30,0						21,5-26,0			SS 4030
4,8	6,0	9,5 +0,6/-1,2	2,0	3,5	27	4,9	1,5-2,5	2900	3100	SS 4806
	8,0						2,5-4,0			SS 4808
	10,0						4,0-6,0			SS 4810
	12,0						6,0-8,0			SS 4812
	14,0						8,0-10,0			SS 4814
	16,0						10,0-11,5			SS 4816
	18,0						11,5-13,5			SS 4818
	20,0						13,5-15,0			SS 4820
	21,0						14,0-15,5			SS 4821
	22,0						15,0-17,0			SS 4822
	25,0						17,0-20,0			SS 4825
	27,0						21,5-24,0			SS 4827
	30,0						20,0-25,0			SS 4830
	35,0						25,0-30,0			SS 4835
5,0	8,0	10,0 +0,5/-1,3	2,1	3,5	27	5,1	2,5-4,0	3100	4000	SS 5008
	10,0						4,0-6,0			SS 5010
	12,0						6,0-8,0			SS 5012
	14,0						8,0-10,0			SS 5014
	16,0						10,0-11,5			SS 5016
	18,0						11,5-13,0			SS 5018
	20,0						13,0-15,0			SS 5020
	25,0						15,0-20,0			SS 5025
30,0	20,0-25,0	SS 5030								

Заклепка открытого типа

Тип **SS**

Стандартный борт

Углеродистая сталь / Углеродистая сталь

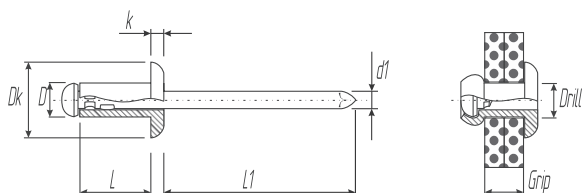

D, мм +0,08/-0,15	L, мм	Dk, мм	k, мм	d1, мм max	L1, мм min	Drill, мм	Grip, мм	H	H	Артикул
6,0	8,0	12,0 +0,6/-1,2	2,5	3,4	27	6,1	1,5-3,0	4300	4800	SS 6008
	10,0						3,0-4,0			SS 6010
	12,0						4,0-6,0			SS 6012
	14,0						6,0-8,0			SS 6014
	15,0						6,0-9,0			SS 6015
	16,0						7,0-9,5			SS 6016
	18,0						10,0-12,5			SS 6018
	20,0						12,5-14,0			SS 6020
	22,0						14,0-16,0			SS 6022
	25,0						14,0-19,0			SS 6025
30,0	19,0-24,0	SS 6030								
6,4	8,0	13,0 +0,4/-1,4	2,7	4,0	27	6,5	1,0-2,5	4900	5700	SS 6408
	10,0						1,0-3,0			SS 6410
	12,0						3,0-6,0			SS 6412
	14,0						6,0-8,0			SS 6414
	15,0						6,0-9,0			SS 6415
	16,0						7,0-9,5			SS 6416
	18,0						9,0-12,0			SS 6418
	20,0						12,0-14,0			SS 6420
	22,0						14,0-16,0			SS 6422
	25,0						16,0-19,0			SS 6425
26,0	16,0-19,5	SS 6426								
30,0	19,0-24,0	SS 6430								